# Monitoring of Vodafone cellsites: annual summary 2018

This report was prepared for: Compliance Manager Vodafone New Zealand Ltd Private Bag 92161 Auckland

Report prepared by: Martin Gledhill

Finalised: 31 August 2018

# About EMF Services and the author of this report

EMF Services is a division of Monitoring and Advisory Services NZ Ltd (MAASNZ), and provides professional measurement and advisory services related to possible health effects of electromagnetic fields (EMFs), such as the extremely low frequency (ELF) electric and magnetic fields found around any wiring, appliances or infrastructure carrying mains electricity, and the radiofrequency (RF) fields produced by radio transmitters and some industrial equipment.

Martin Gledhill has an MA degree in Natural Sciences (Physics) and an MSc in Medical Physics. He is a member of the Australasian Radiation Protection Society and of the Bioelectromagnetics Society. Before forming MAASNZ he was head of the non-ionising radiation section at the National Radiation Laboratory of the New Zealand Ministry of Health. In this position he provided advice to central and local government, the public and industry on the health effects of EMFs, and carried out measurement and assessment services in this area. This work included providing policy advice to the Ministries of Health and the Environment, preparation of public information material, presenting expert evidence at local authority and Environment Court hearings, and assessing exposures to EMFs by both measurements and calculations.

EMF Services P O Box 17 Clyde 9341 New Zealand info@emfservices.co.nz www.emfservices.co.nz +64 27 545 4217

# Monitoring of Vodafone cellsites: annual summary 2018

### 1 Introduction

EMF Services, which provides independent electromagnetic field (EMF) measurement services, has been commissioned by Vodafone to measure exposures around their cellsites. This report presents the results of measurements at ten sites carried out between January and August 2018. The purpose of the tests is to evaluate exposures to radiofrequency (RF) fields near Vodafone cellsites to determine the maximum exposure at the time the measurements were made, and the maximum possible exposure should all the equipment at the Vodafone site (and any other transmitters nearby) operate at full power. Exposures are compared against the appropriate limits in New Zealand Standard 2772.1:1999 *Radiofrequency Fields Part 1: - Maximum exposure levels 3 kHz - 300 GHz*, as required by the Resource Management (National Environmental Standards for Telecommunications Facilities) Regulations 2016 ("the NES").

Vodafone has made the following statement about the testing:

Vodafone is committed to providing greater transparency and access to information for all our stakeholders on the issues of mobile phones, masts and health. To proactively address these issues and to better inform and educate our customers, employees and the general public, Vodafone has established an independent field monitoring programme to measure and monitor the total electromagnetic radiofrequency (RF) field strength in the environment, from all sources (i.e., TV, radio, mobile telephony base stations etc), near our mobile base stations.

The aim of the programme is to provide the public with independent, reliable and direct information on the total electromagnetic RF levels in the environment.

In order to preserve the transparency and validity of information provided, as well as the ongoing updating thereof, Vodafone has requested that EMF Services assume the programme's overall scientific management. As an independent organisation EMF Services selects the locations to undertake the monitoring and measurement of RF fields, and moreover, supervises and verifies the correctness of all information, entirely independent of Vodafone.

# 2 Overview of measurement methodology

A full description of the measurement equipment, methodology, post-processing of the data and uncertainty analysis for the monitoring is presented in EMF Services Report 2018/39 *Monitoring of Vodafone cellsites: methodology.. Revision 2.* 

In summary, a preliminary survey of the area around a site is made using a broadband measurement meter. This meter measures the overall exposure from all transmitters which might make a contribution to the total, but is not able to distinguish the individual contributions from each transmitter. Because the exposure limit in NZS 2772.1:1999 depends on the transmitter frequency, and cellsites transmit at several frequencies, it is

not possible to use the broadband measurements to determine precisely the exposure as a percentage of the public limit in the Standard. Nor is it possible to use the measurements to determine what the exposure would be if all transmitters at a nearby cellsite were operating at full power. On the other hand, the broadband measurements provide a ready means to find how exposures vary around a site, and find the locations where exposures tend to be highest.

Once the location(s) where exposures are highest have been determined using the broadband meter, a narrowband meter is used to take further measurements. The narrowband meter is able to determine the contribution to exposure in different frequency bands, and measure components of cellphone base station transmitters from which the maximum possible exposure from that transmitter can be determined. Narrowband measurements are used to:

- Determine the contributions from different transmitters to the overall total;
- Evaluate the exposure at the time of measurement as a percentage of the public limit in NZS 2772.1:1999;
- Determine what the maximum possible exposure would be if all the Vodafone equipment, and any other transmitters nearby, were operating at full power.

The measurement method used tends to result in the exposure at the time of measurement, and the maximum possible exposure, being overestimated. It is also worth noting that, in practice, there is very little likelihood of all transmitters at a cellsite operating simultaneously at full power.

# 3 Summary of results

#### **3.1** Results for 2018

Figure 1 presents a histogram of the maximum exposure from all sources (ie from the Vodafone site of interest and any other transmitters) measured during the survey with the narrowband meter, at the ten sites surveyed in the period. Results are expressed as a percentage of the public limit in NZS 2772.1:1999.

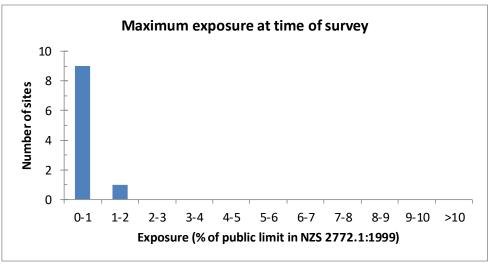


Fig 1. Histogram of maximum exposures found at the time of measurement at the ten sites surveyed in 2018.

Two of the sites were near a site belonging to another mobile phone network operator.

Figure 2 shows the maximum possible exposure at the ten sites, if all the Vodafone transmitters, and transmitters belonging to other cellular network operators nearby, were to transmit simultaneously at full power.

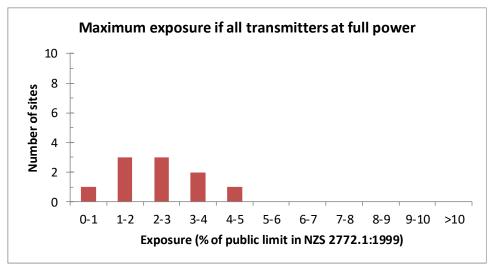


Fig 2. Histogram of maximum possible exposures at the ten sites surveyed in 2018, if they and all other sites nearby were to transmit at full power.

### 3.2 Results for 2016-2018

Figures 3 and 4 present the same data for all thirty sites measured over 2016, 2017 and 2018.

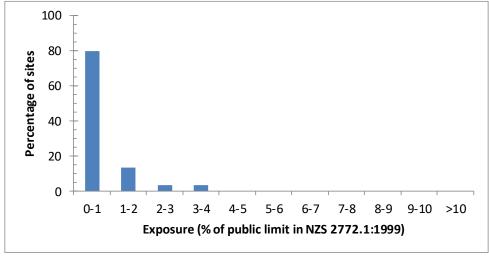


Fig 3. Histogram of maximum exposures found at the time of measurement at all thirty sites surveyed from 2016 to 2018.

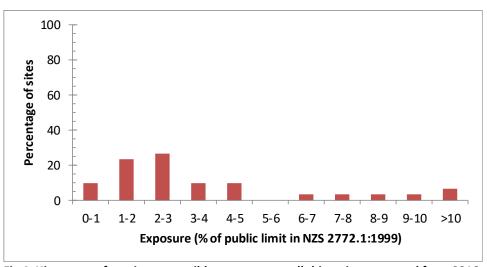


Fig 4. Histogram of maximum possible exposures at all thirty sites surveyed from 2016 to 2018, if they and all other sites nearby were to transmit at full power.

## 4 Results table

A summary of results for the individual sites is presented in the table below.

Date	Type of site*	Max exposure	Max possible	Comments
measured		at time of	exposure (%	
		survey (% of	of public limit)	
		public limit)		
8/02/2018	Lamppost,	0.65	2.3	2degrees
	residential			nearby
				J
20/05/2018	Lamppost,	1.6	4.8	
	residential			
31/05/2018	Lamppost,	0.8	2.9	
	residential			
8/02/2018	Rooftop,	0.88	3.6	
	residential			
9/02/2018	Lamppost,	0.68	3.5	
	residential			
2/05/2018		0.45	1.3	
	residential			
2/05/2018	Lamppost,	0.37	1.6	
	residential			
2/05/2018	Lamppost,	0.74	2.8	
	residential			
22/05/2018	Lamppost,	0.11	0.43	
	residential			
23/08/2018	Monopole,	0.43	1.9	2degrees
	residential			nearby
	measured  8/02/2018  20/05/2018  31/05/2018  8/02/2018  9/02/2018  2/05/2018  2/05/2018  2/05/2018  2/05/2018  2/05/2018	measured  8/02/2018 Lamppost, residential  20/05/2018 Lamppost, residential  31/05/2018 Lamppost, residential  8/02/2018 Rooftop, residential  9/02/2018 Lamppost, residential  2/05/2018 Lamppost, residential	measured         at time of survey (% of public limit)           8/02/2018         Lamppost, residential         0.65           20/05/2018         Lamppost, residential         1.6           31/05/2018         Lamppost, residential         0.8           8/02/2018         Rooftop, residential         0.68           9/02/2018         Lamppost, residential         0.45           2/05/2018         Lamppost, residential         0.37           2/05/2018         Lamppost, residential         0.74           22/05/2018         Lamppost, residential         0.11           23/08/2018         Monopole, 0.43	measured         at time of survey (% of public limit)         exposure (% of public limit)           8/02/2018         Lamppost, residential         0.65         2.3           20/05/2018         Lamppost, residential         1.6         4.8           31/05/2018         Lamppost, residential         0.8         2.9           8/02/2018         Rooftop, residential         0.88         3.6           9/02/2018         Lamppost, residential         0.68         3.5           2/05/2018         Lamppost, residential         0.45         1.3           2/05/2018         Lamppost, residential         0.37         1.6           2/05/2018         Lamppost, residential         0.74         2.8           22/05/2018         Lamppost, residential         0.11         0.43           23/08/2018         Monopole,         0.43         1.9

<sup>\*</sup>Type of site shows where the antennas are mounted, and the predominant nature of the surrounding area.